



CSI
Certificazione e Testing

RAPPORTO DI PROVA
(Test Report)

Pag. **24**
di/of
pag. **24**


N° **0058/DEU/CPD/06**

Data: **27/06/2006**
Date:

Tested element: **SGG Stadip Silence 66.2**

Sample surface area S = 1,9 m²
Volume of receiving room V = 86 m³
Volume of source room 98 m³

FREQ. Hz	R dB
100	29,1
125	31,3
160	34,2
200	31,1
250	32,9
315	33,4
400	33,6
500	36,4
630	37,9
800	38,7
1000	39,6
1250	40,0
1600	39,8
2000	41,1
2500	44,5
3150	47,4
4000	51,6
5000	53,9

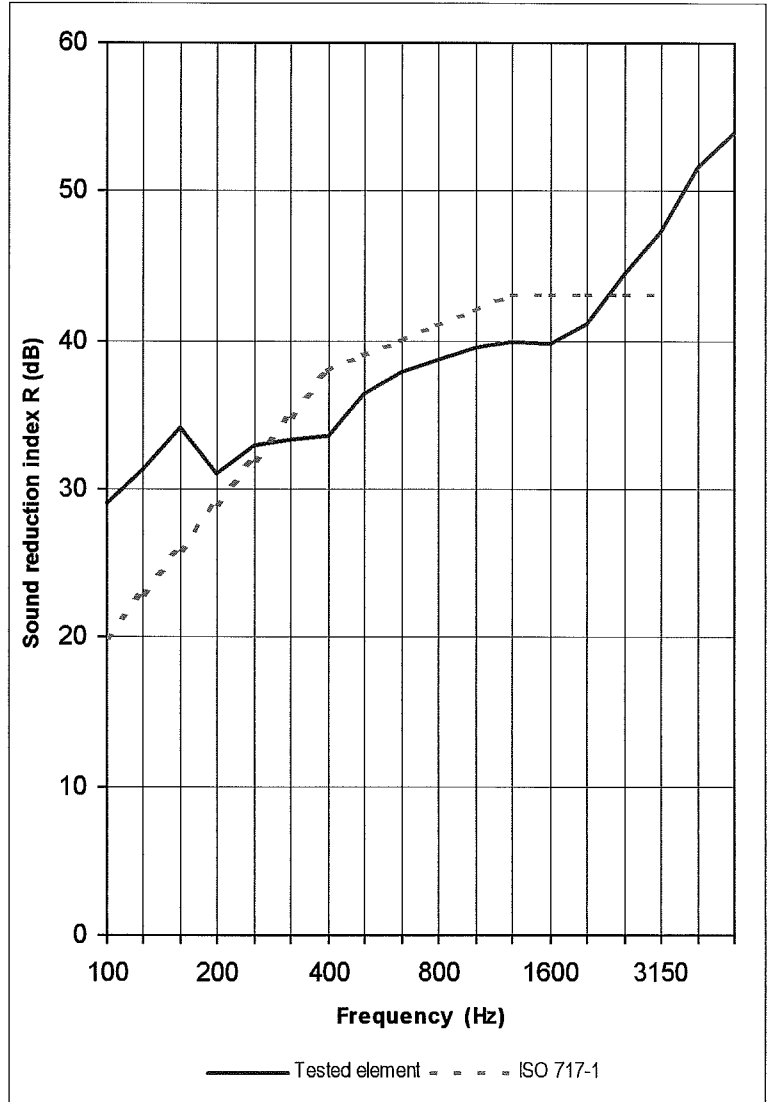

Rating according to ISO 717-1 (in the band 100 ÷3150 Hz) based on laboratory measurements:

R_w (C;C_{tr}) = 39 (0 ; -2) dB

IL RESP. DIV. COSTRUZIONI

Construction Division Head

Ing. P. Mele

IL RESP. DEL CENTRO

Managing Director

Ing. P. Cau