



CSI
Certificazione e Testing

RAPPORTO DI PROVA
(Test Report)

Pag. 11

di/of

pag. 12

N° 0008/DC/ACU/10

Data: 18/01/2010

Date:


Tested element: SGG CLIMAPLUS 6 (10 Ar) 4

Specimen surface
Receiving room volume
Source room volume

S = 1,88m²
V = 86m³
98m³

FREQ. Hz	R dB
100	23,8
125	24,6
160	25,7
200	24,6
250	21,8
315	21,9
400	23,9
500	27,6
630	30,1
800	35,3
1000	41,5
1250	45,5
1600	44,0
2000	39,6
2500	41,9
3150	39,9
4000	44,6
5000	48,4

$R_w (C; C_{tr}) = 33 (-1 ; -3) \text{ dB}$

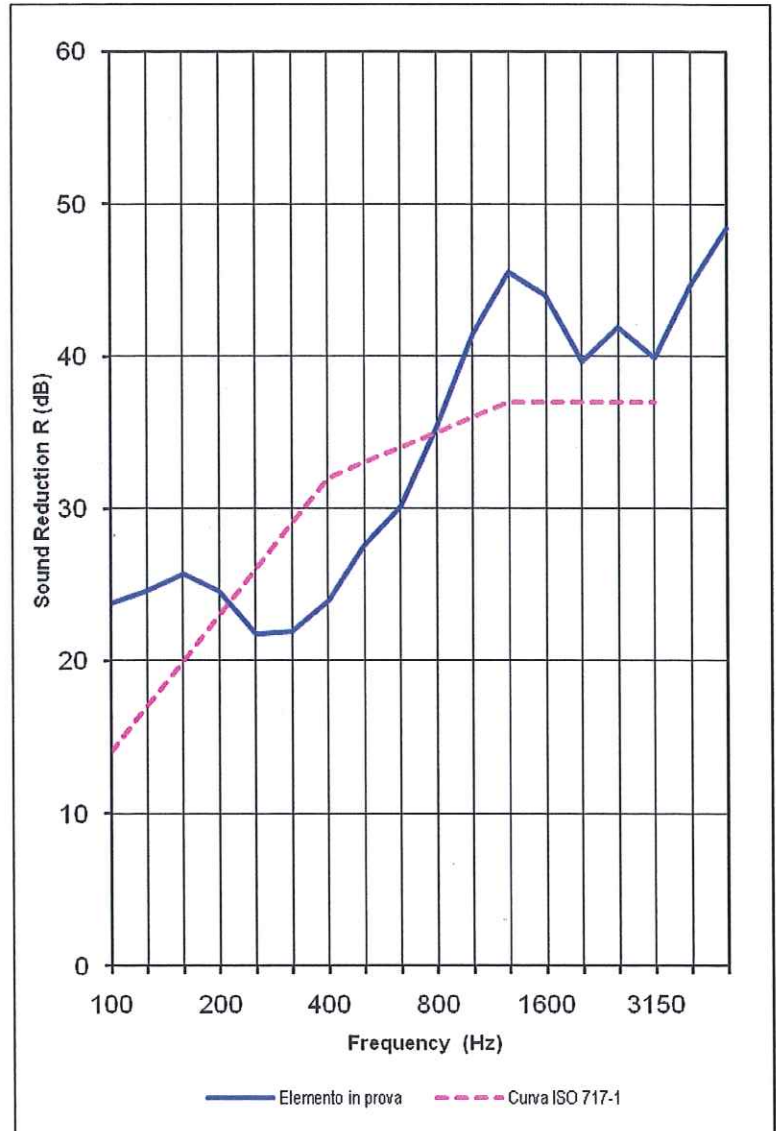

Rating according to ISO 717-1 (in the band 100 ÷ 3150 Hz) based on laboratory measurements: