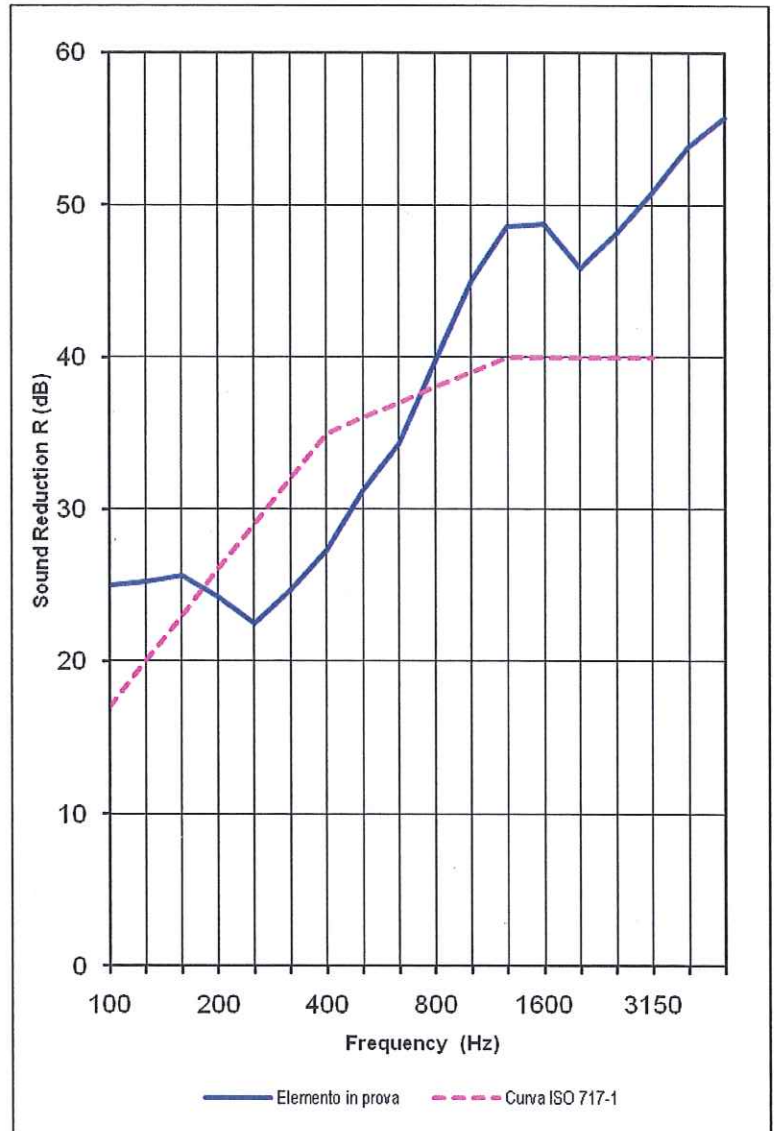


Tested element: **SGG CLIMAPLUS 22-1SI (10 Ar) 6**


 Specimen surface
 Receiving room volume
 Source room volume

 S = 1,88m²
 V = 86m³
 98m³

FREQ. Hz	R dB
100	25,0
125	25,2
160	25,6
200	24,3
250	22,5
315	24,7
400	27,3
500	31,2
630	34,3
800	39,6
1000	45,0
1250	48,6
1600	48,7
2000	45,8
2500	48,1
3150	50,8
4000	53,8
5000	55,7

R_w (C;C_n) = 36 (-1 ; -4) dB


Rating according to ISO 717-1 (in the band 100 ÷ 3150 Hz) based on laboratory measurements:

IL RESP. Divisione Costruzioni
Division Head
Paolo Mele

IL RESP. DEL CENTRO
Managing Director
Pasqualino Cau
